

# **Instruction Manual**


Model: NEJE Max 4 V2




#### 1 Install the control box and then install the X-axis



#### 2 Install the external frame

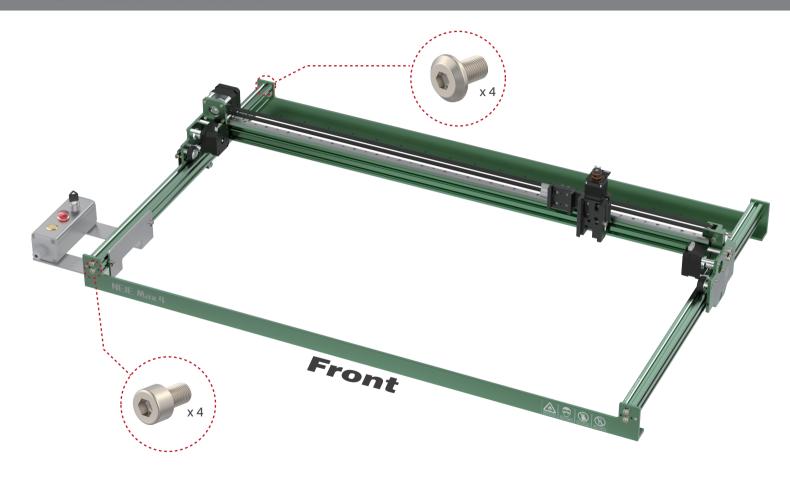


### 3 Install the belt tensioner and route the belt properly

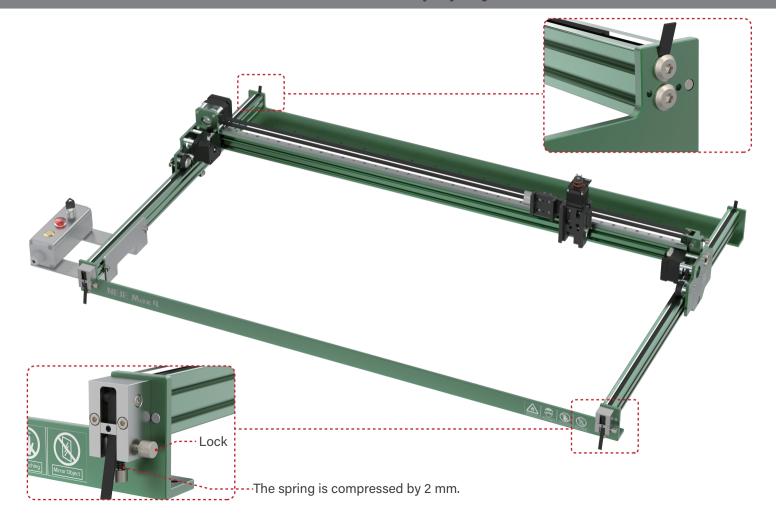


### 4 Install the cable carrier and tidy up the wiring



### **5 E80 Module Wiring Diagram**

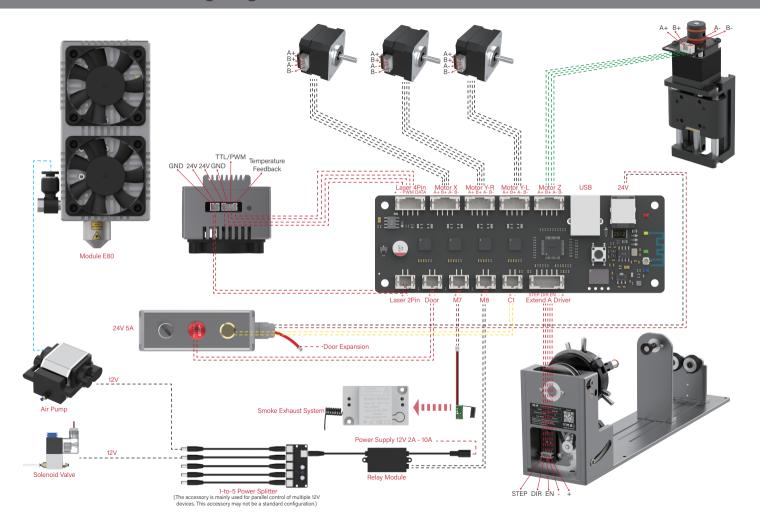

#### **6 E160 Module Wiring Diagram**

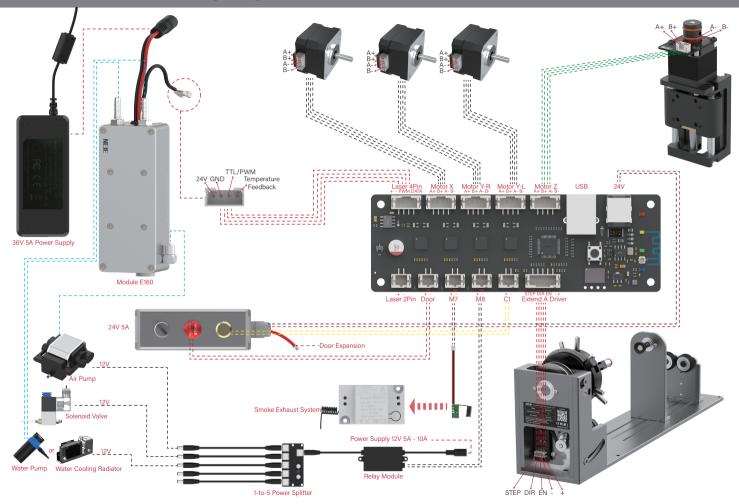

Manufacturer: Shenzhen Zhi xinjie Technology Co., LTD.

Address: Building 4 Floor 3, ShanKeng Inner Ring Road No.4, ShanKeng Industry Park, ShanXia Village, PingHu Town, LongGang District, ShenZhen.

Contact Us: http://neje.club



Outong GmbH Brehmstr.56.40239 Duesseldorf Germany info@outong.de





## **ADANGER**

Laser Class 4





VISIBLE LASER RADIATION . AVOID EYE OR SKIN EXPOSURE TO DIRECT OR SCATTERED RADIATIO

For engraving or cutting wood, fabric, leather, ceramics, stone, glass, metal and other materials DIN EN 60825-1: 2015-07







